


OFFICE OF THE MARION COUNTY SURVEYOR
SECTION RECORD CORNER
SECTION 27 TOWNSHIP 17 RANGE 5
DATE: 10-6-99 -- 8-06-04
PARTY CHIEF: -Kiste- Wilcoxon
CREW: _____
TYPE OF MARKER: Found brass plug & plate 2" down
METHOD OF ESTABLISHMENT: County: 10-12-94

IN. S.P.C. E ZONE, NAD 83
NAME: 17052703
N: 516297.3510(m)
E: 76789.3560(m)

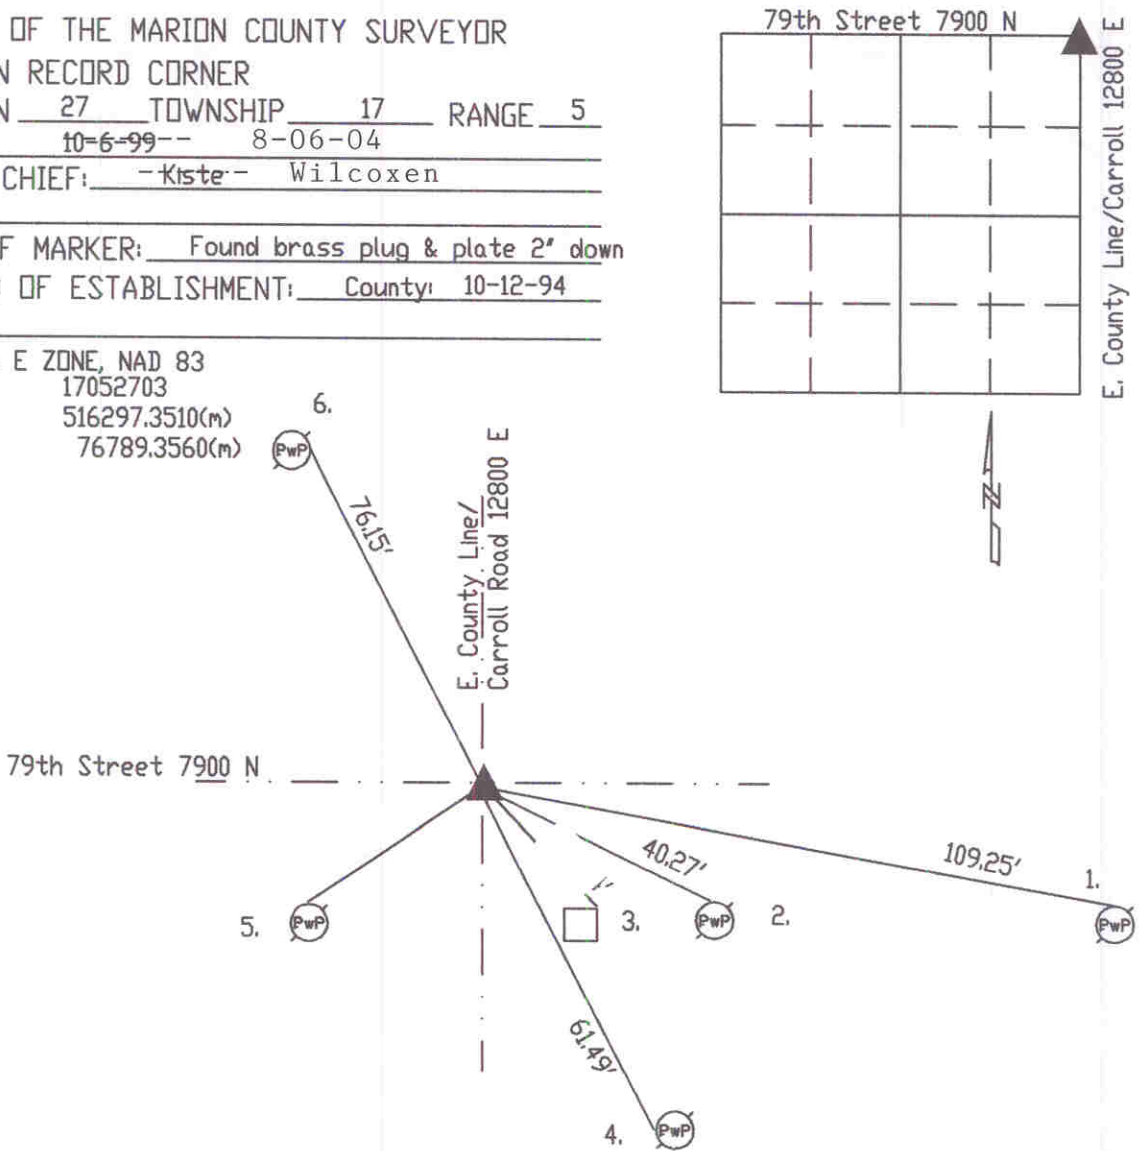

Original post set 1821, by Laughlin with witnesses: 12" hickory S 25 E 13 links, 14" beech N 37 W 48 links per Marion County Atlas pg. 16. Hosbrook 2-1849 called distance to QQ to N, but no type of monument per Lawrence Township Legal Survey Book pg. 11. Hosbrook 2-1849 per Lawrence Township Legal Survey Book pg. 15 called corner "E" with witnesses still standing. Hosbrook per Lawrence Township Legal Survey Book pg. 16 "mislabels" Sec. 27 as Section 31. Duplicate survey for page 11 & 36. Section 5 were incorrectly marked on page 16. 10-31-49 Hearne called stone 2" down per tie card. 8-22-63 Burres gave no reference to type of monument. 5-22-70 McLand called stone 15" down. 5-30-72 SeFranka called the same. Schneider Job#16392 called PK nail set per MCSO ties. Bearings and distances were given to corners W & S. Cripe, Paul I. Inc. Job#7426 gave the same distances. 6-8-78 Hancock County called brass plug & plate set over stone found 18" down. Wilcoxon 6-25-82 pulled new ties. Re-tied by Wilcoxon 10-12-94. Re-tied 10-6-99 by Kiste.

SC752703

REF.	DISTANCE	DESCRIPTION
1.	109.25'	PK nail N PwP#44-251HB 50'up
2.	40.27'	PK nail N PwP#70-251HB 8'up
3.	24.99'	NE corner of concrete post leaning East 3" up
4.	61.49'	PK nail SW PwP#71-251HB 20'up
5.	25.65'	Found PK nail N PwP#45-251HB 12'up
6.	76.15'	Found PK nail E PwP#5-251HB 20'up